


### KS Series Standard Precision Interchangeable Thermistors

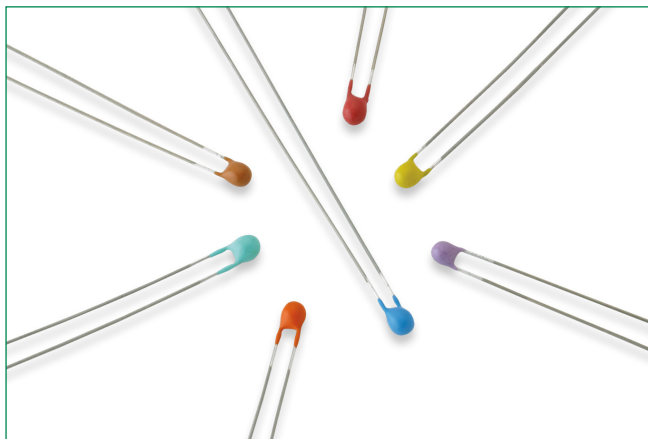


#### Description

Littelfuse precision interchangeable thermistors are low cost, highly accurate, stable devices designed specifically for temperature sensing and control applications. They are particularly suited for uses where their precision interchangeability eliminates the necessity for costly individual circuit calibration.

#### Options

- Non-standard resistance values and tolerances
- Special lead materials and lengths
- Special encapsulants or probe housings

#### Dimensions

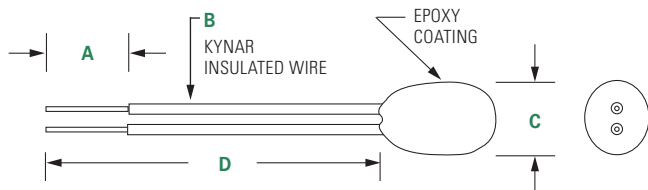


Dimensions shown in inches.

| A             | B                | C             | D               |
|---------------|------------------|---------------|-----------------|
| 0.250"<br>Nom | 30 AWG<br>0.010" | 0.095"<br>Max | 1.5"<br>±0.250" |

#### Features

- High accuracy
- Fast thermal response
- Low cost
- Small size
- Epoxy encapsulated
- High stability
- Long life
- R/T Curve-matched

#### Part Numbering System

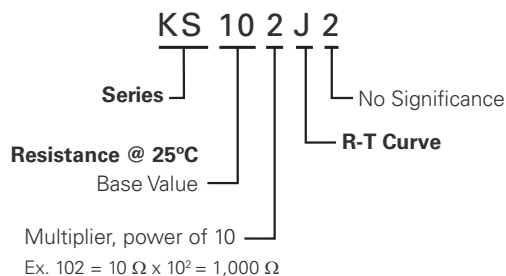

**Note:** Not all combinations of Part Number codes are available. Contact Littelfuse for details.

## KS Series Standard Precision Interchangeable Thermistors

### Specifications

| Part Number | Resistance Ohms @25°C | Accuracy (±°C) 0-70°C | R-T Curve | Temperature Coefficient (% / °C) @ 25°C | Beta (K) 0-50°C | Max. Power Rating (mW) | Dissipation Constant, Nominal (mW/°C) | Thermal Time Constant, Max. - Still Air (seconds) | Thermal Time Constant, Max. - Well Stirred Oil (seconds) | Temperature Rating (°C) | Storage & Operation Temp for Best L/T Stability (°C) |
|-------------|-----------------------|-----------------------|-----------|-----------------------------------------|-----------------|------------------------|---------------------------------------|---------------------------------------------------|----------------------------------------------------------|-------------------------|------------------------------------------------------|
| KS102J2     | 1000                  | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS222J2     | 2252                  | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS302J2     | 3000                  | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS502J2     | 5000                  | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS602J2     | 6000                  | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS103G2     | 10000                 | ±0.1°C                | G         | -4.04                                   | 3575            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS103J2     | 10000                 | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS103J34    | 10000                 | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS203J2     | 20000                 | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS303J2     | 30000                 | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS503J2     | 50000                 | ±0.1°C                | J         | -4.4                                    | 3892            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS503R2     | 50000                 | ±0.1°C                | R         | -4.68                                   | 4140            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |
| KS104R2     | 100000                | ±0.1°C                | R         | -4.68                                   | 4140            | 30                     | 1                                     | 10                                                | 1                                                        | -80 to +135             | -80 to +75                                           |

**Disclaimer Notice** - Information furnished is believed to be accurate and reliable. However, users should independently evaluate the suitability of and test each product selected for their own applications. Littelfuse products are not designed for, and may not be used in, all applications. Read complete Disclaimer Notice at: [www.littelfuse.com/disclaimer-electronics](http://www.littelfuse.com/disclaimer-electronics)